

Fan Speed Monitor Board  
Special Assembly Instructions

- **Remove solder mask for attaching brass tube.**
- **The silkscreen label for + on C4 is incorrect. Insert the cap with positive lead down.**
- **Cut one tab off the photo-sensor that mounts on the bottom of the board.**
- **Cut trace above C1 designator and add wire from U4 pin 4 to R5.**
- **Add 1uF tantalum cap from U4 pin 16 to ground (see sample).**
- **Add wire to ground pin 1 & 7 of U4.**
- **Be careful not to over heat the film capacitor C3.**